

# PART I

## EXISTING CONDITIONS REFERENCE INFORMATION

### Summary of Port of Albany Field Investigation:

For detailed results from the survey, please review the attached appendices and reference drawings. The text below summarizes the results from each aspect of the inspection:

## PART I

- Topside Survey  
MRCE Inspected the topside of the Sheds Nos 1 to 3 and heavy lift rail wharf on December 18, 2024 and again on March 12, 2025. Our investigation found the wharf deck in need of repair. Asphalt patching has masked deteriorating deck conditions and insufficiency for deck loading conditions. Numerous deck areas had inadequate concrete cover and exposed rebar at the surface or beneath a thin layer of asphalt. Expansion joints were typically more severely deteriorated and filled with asphalt as well, the compressible material within the joints having been deteriorated. A photo log of typical topside conditions is attached.
- Underside Deck Survey  
MRCE inspected the underside of the deck between March 11, 2025 and March 12, 2025. The decks have cracking parallel and adjacent to the existing rail slots as well as the filled rail slots. A few spans have parallel cracking in between the rail slots as well. Cracking is also apparent emanating diagonally or orthogonally from the pile caps. Efflorescence and “stalactite” type calcite formations are common amongst the deck cracks. The calcite formations indicate water leaking through the deck slab. Crack map plans are in the reference drawings.

## PART II

- Timber Fendering  
MRCE inspected the timber fendering between March 11, 2025 and March 12, 2025. Generally, the timbers south of Bent 27 are in good condition, some locations have damaged/missing chocks or bolts. From Bent 27 to Bent 58 a majority of the timbers are damaged or missing. This section will need a full replacement.
- Caisson Cap Beams (Bents) and Fascia Beams  
MRCE inspected the Caisson Cap Beams (Bents) and Fascia Beams between March 11, 2025 and March 12, 2025. On March 13, 2025 Seaway Diving performed a diving inspection of the caissons at 11 bents, with generally fair conditions and only minor coating loss/pitting and near original steel wall thicknesses. The bent conditions are varied and as indicated on the plans.

## PART III

- Pile Caps  
MRCE inspected the 46 individual heavy lift rail pile caps between March 11, 2025 and March 12, 2025. On March 13, 2025 Seaway Diving performed a diving inspection of the piles at 9 pile caps. Overall, only 15 pile caps are in satisfactory conditions, with the majority of the caps (31) in a moderate to severe deterioration condition. Eleven of the pile caps had formwork remaining on the crown of the cap, this prevented inspection of the interface between the pile cap and the deck. General Pile Cap conditions apparent were gaps between the pile cap and the deck underside, water damage at the top and sides of the pile cap, and cracking on the bottom or sides of the pile cap, sometimes exposing pile cap reinforcing steel.
- Photos  
All relevant inspection photos are attached.

# Topside Photos



Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 1: Bent 1



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 2: Bent 1



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:1 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 3: Bent 1



Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 4: Bent 1 Expansion Joint



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:2 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 5: Bent 2



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 6: Bent 5



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:3 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 7: Bent 5



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 8: Bent 5



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:4 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 9: Bent 5



Tags:Topside

Taken by:Matthew Seinuk


Date taken:12/18/2024

Media 10: Bent 6



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:5 of 48



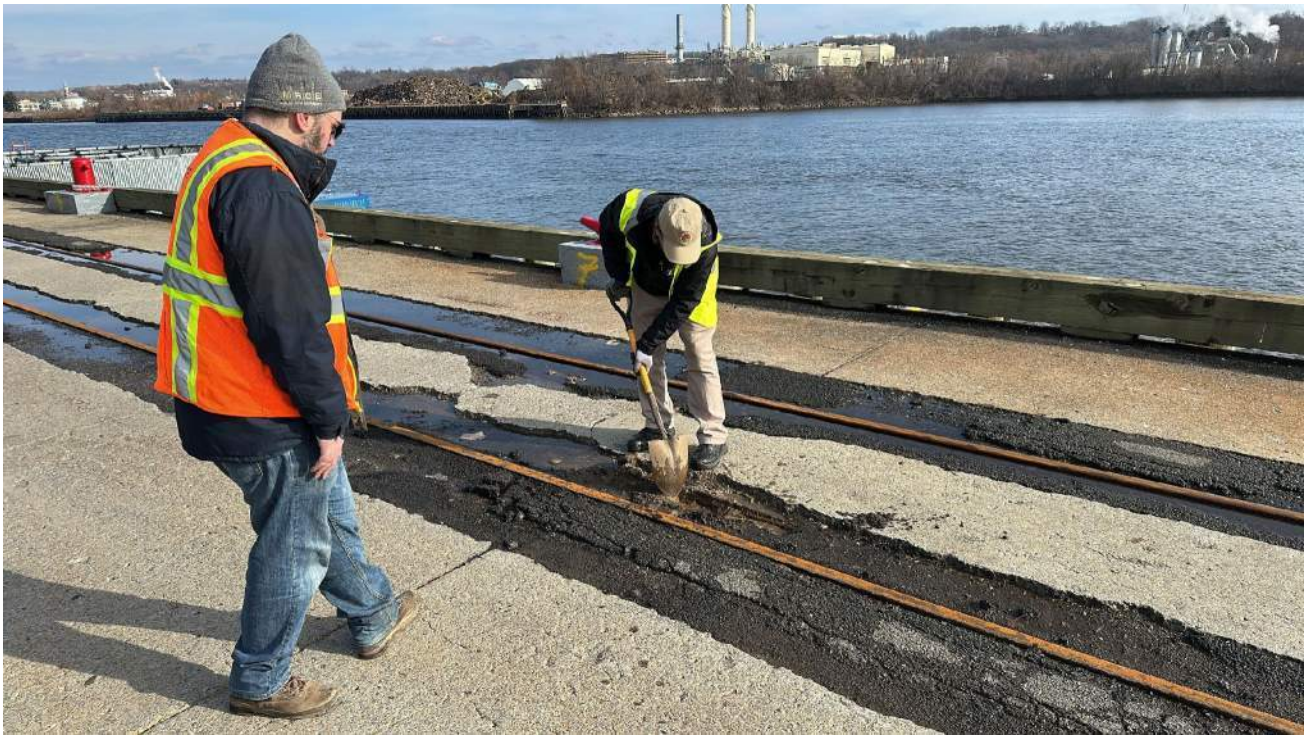

Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 11: Bent 6



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 12: Bent 6



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:6 of 48






Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 13: Bent 7

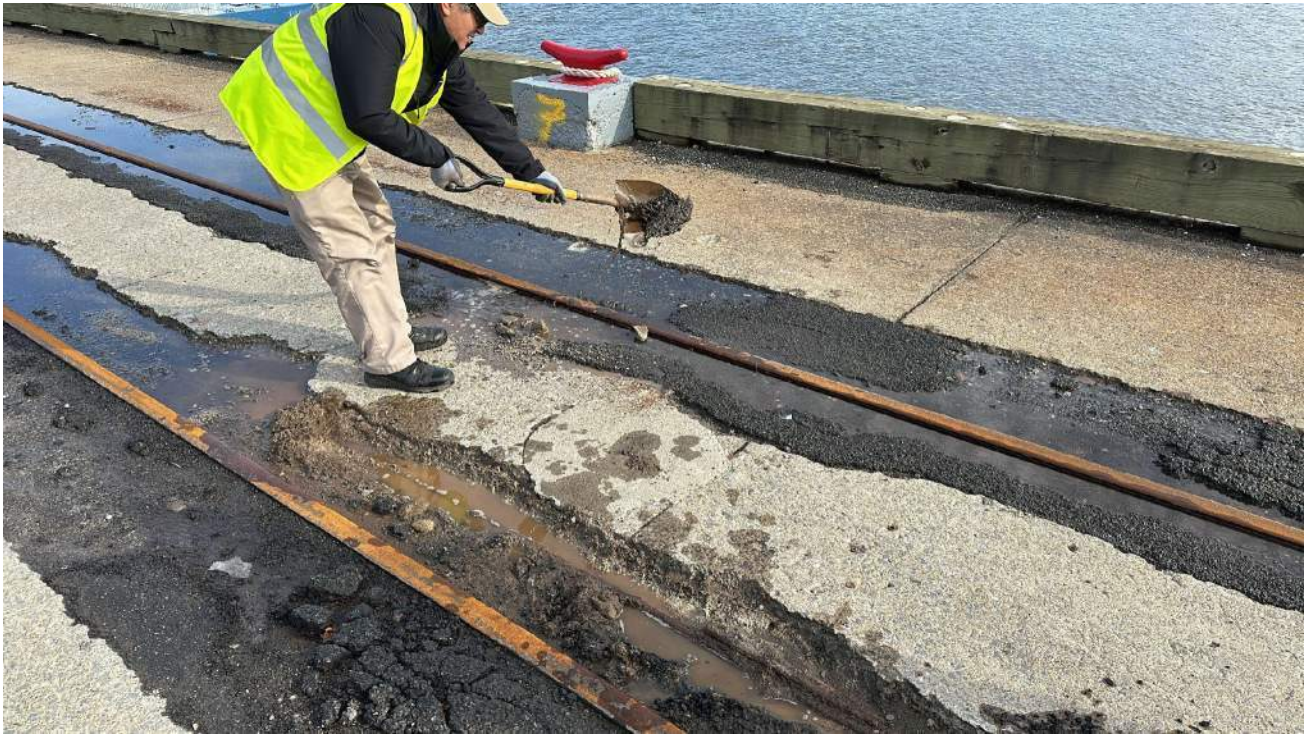

Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 14: Bent 7



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:7 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 15: Bent 7



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 16: Bent 8



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:8 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 17: Bent 8



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 18: Bent 8



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:9 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 19: Bent 9



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 20: Bent 9



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:10 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 21: Bent 9



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 22: Bent 9



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:11 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 23: Bent 9



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 24: Bent 11



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:12 of 48






Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 25: Bent 13

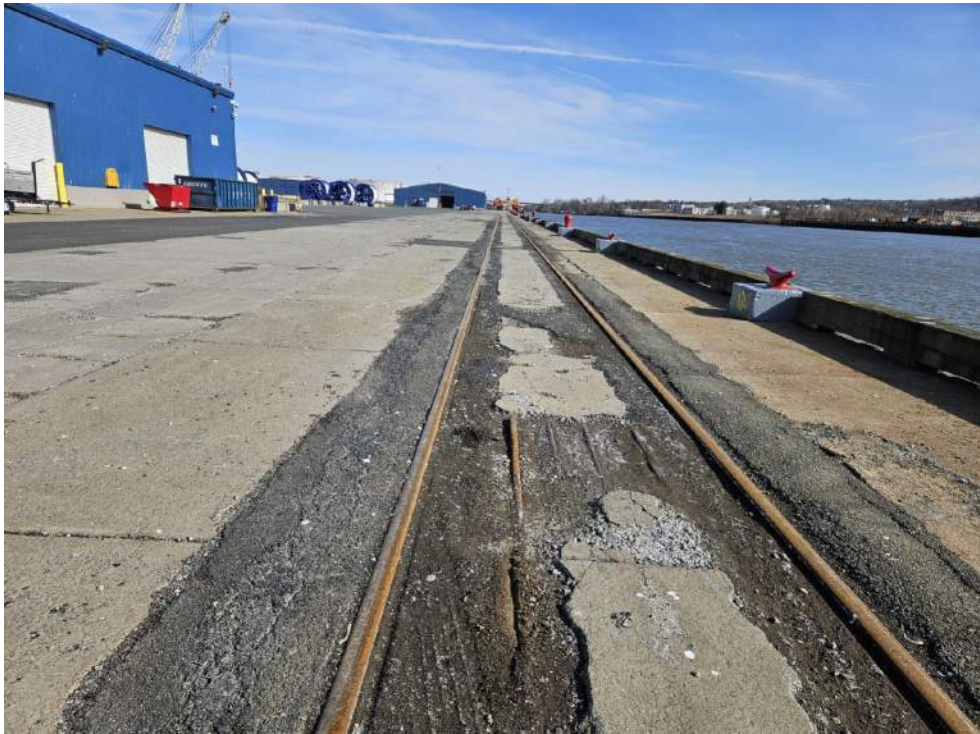

Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 26: Bent 15



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:13 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 27: Bent 15



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 28: Bent 16



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:14 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 29: Bent 16



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 30: Bent 16



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:15 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 31: Bent 16



Tags:Topside

Taken by:Matthew Seinuk


Date taken:12/18/2024

Media 32: Bent 16



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:16 of 48



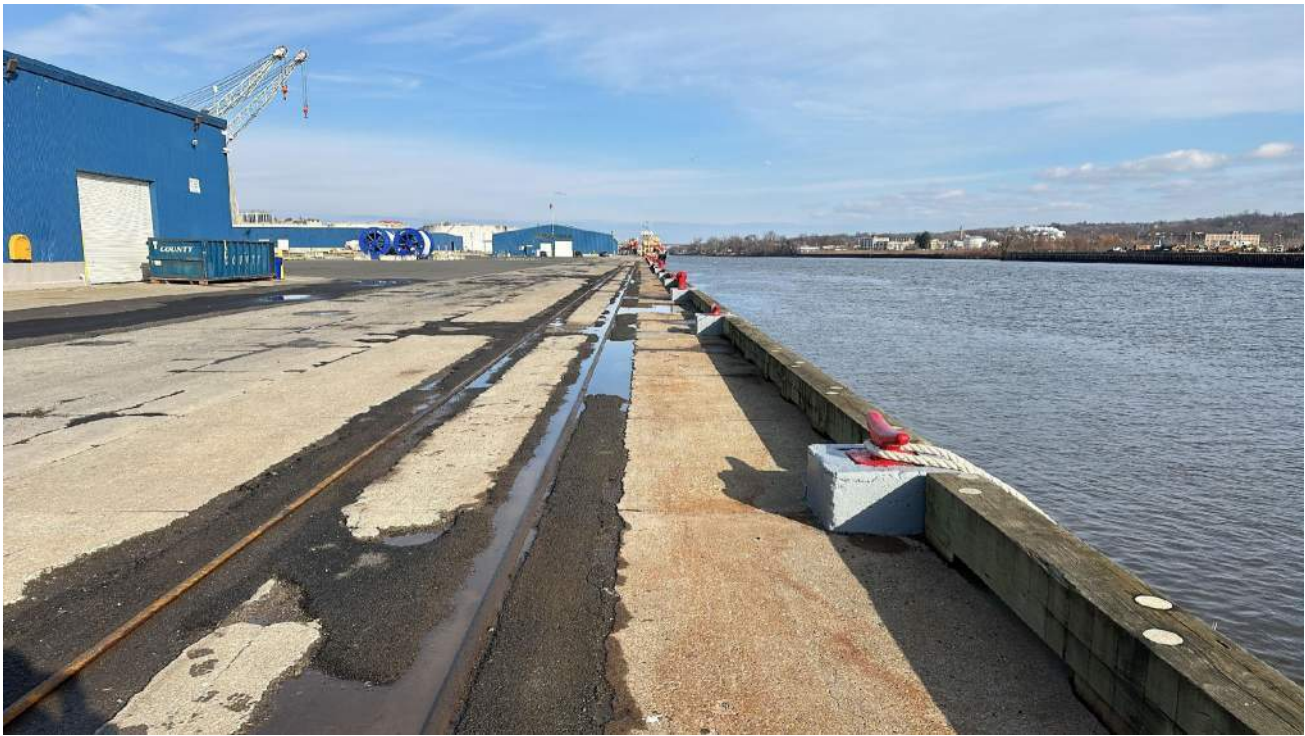

Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 33: Bent 17



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 34: Bent 18



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:17 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 35: Bent 18



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 36: Bent 19



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:18 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 37: Bent 19



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 38: Bent 19



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:19 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 39: Bent 20



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 40: Bent 20



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:20 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 41: Bent 21



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 42: Bent 21



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:21 of 48





Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 43: Bent 21		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 44: Bent 21		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:22 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 45: Bent 21



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 46: Bent 21



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:23 of 48





Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 47: Bent 22		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 48: Bent 22		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:24 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 49: Bent 22



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 50: Bent 22



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:25 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 51: Bent 22



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 52: Bent 23



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:26 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 53: Bent 23



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 54: Bent 24



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:27 of 48





Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 55: Bent 24		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 56: Bent 24		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:28 of 48





Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 57: Bent 25		



Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 58: Bent 25		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:29 of 48





Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 59: Bent 25		



Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 60: Bent 25		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:30 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 61: Bent 25



Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 62: Bent 27




Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:31 of 48





Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 63: Bent 29		

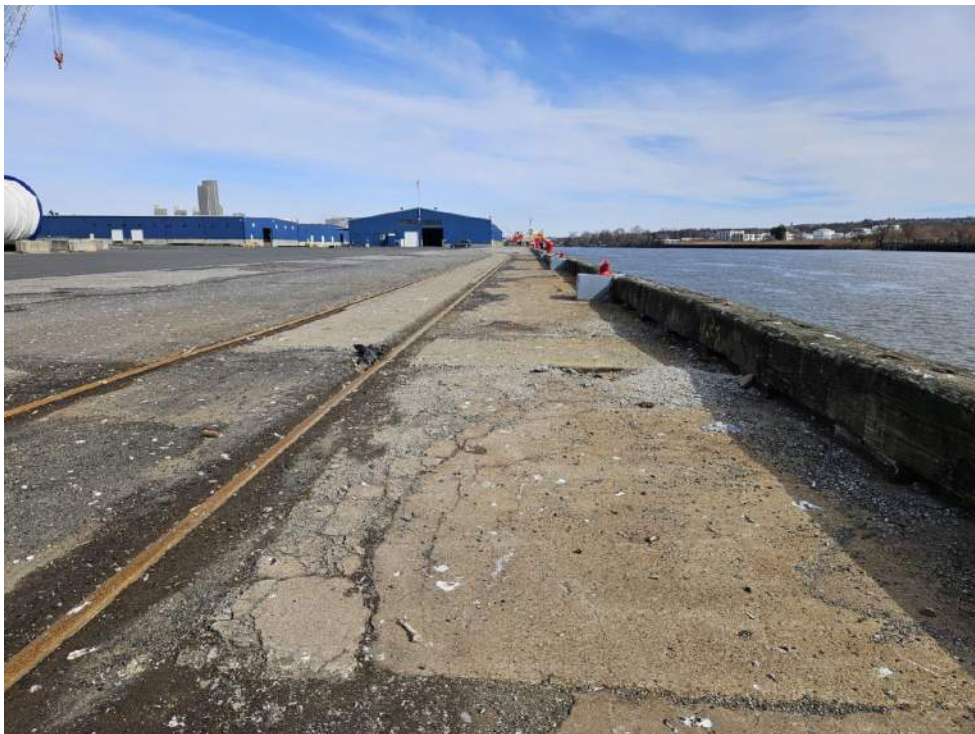


Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 64: Bent 32		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:32 of 48



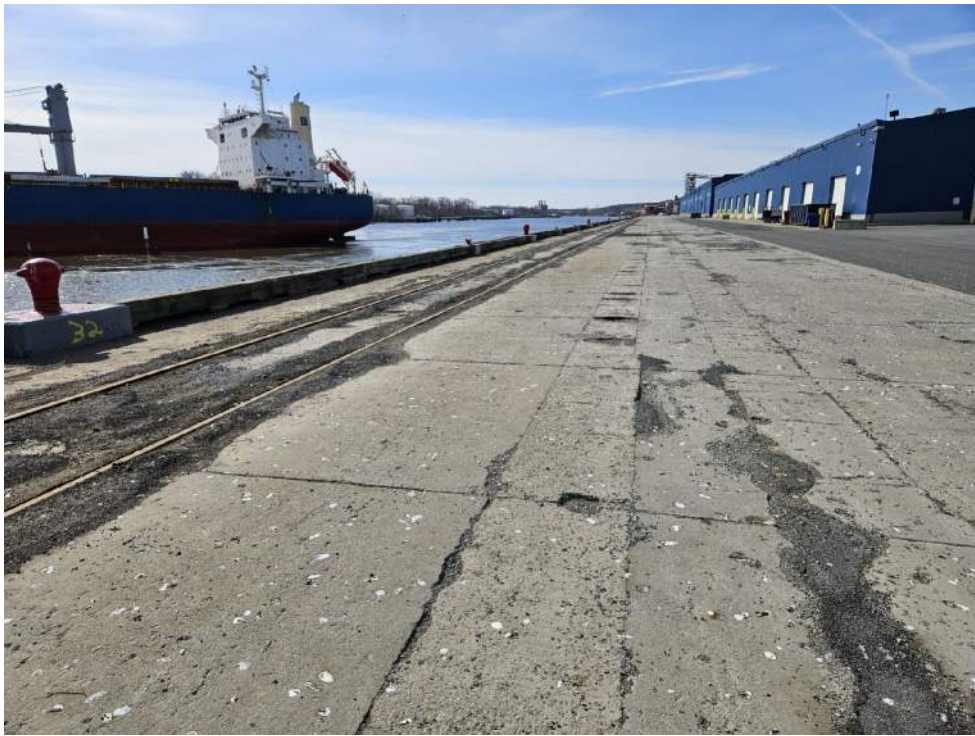

Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 65: Bent 32		




Tags:Topside, Report Photos	Taken by:Anthony DeVito	Date taken:03/12/2025
Media 66: Bent 32		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:33 of 48



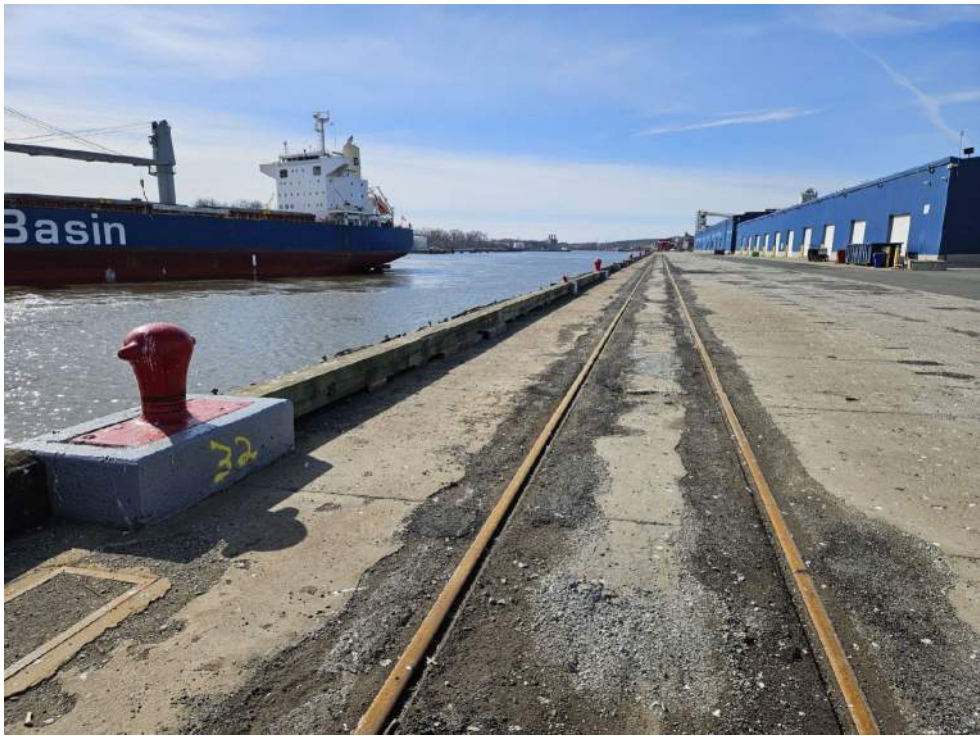

Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 67: Bent 32



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 68: Bent 33



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:34 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 69: Bent 33



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 70: Bent 33



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:35 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 71: Bent 33



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 72: Bent 33



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:36 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 73: Bent 33



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 74: Bent 33



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:37 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 75: Bent 33



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 76: Bent 33



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:38 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 77: Bent 32



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 78: Bent 34



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-02

Page number:39 of 48





Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 79: Bent 38		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 80: Bent 33		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:40 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 81: Bent 33



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 82: Bent 42



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:41 of 48





Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 83: Bent 42		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 84: Bent 42		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:42 of 48





Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 85: Bent 47		



Tags:Topside	Taken by:Matthew Seinuk	Date taken:12/18/2024
Media 86: Bent 48		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:43 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 87: Bent 49



Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 88: Bent 58



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:44 of 48





Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 89: Bent 58



Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 90: Bent 58



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:45 of 48






Tags:Topside

Taken by:Matthew Seinuk

Date taken:12/18/2024

Media 91: Bent 58

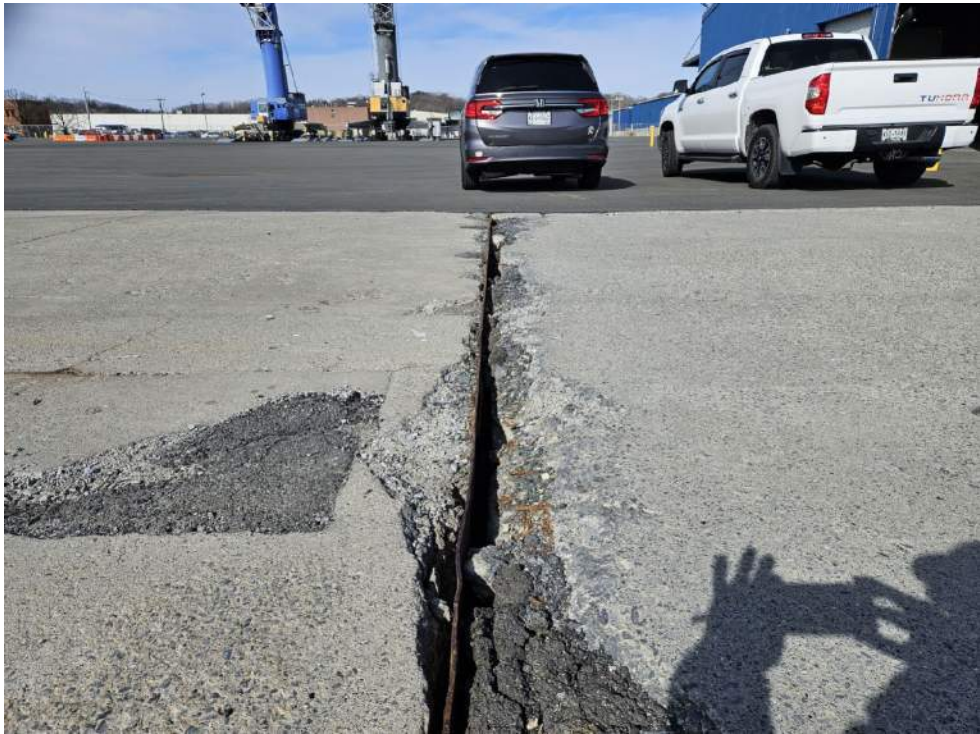

Tags:Topside, Report Photos

Taken by:Anthony DeVito

Date taken:03/12/2025

Media 92: Bent 58 Expansion Joint



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-02	Page number:46 of 48



# Deck Photos





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 1: Bent 1, P-1, Underside between bent 1 and 2.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 2: Bent 2 & 3, P-2, Underside between Bent 2 & 3.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:1 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 3: Bent 2&3, P-2, Underside between Bents 2 & 3.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 4: Bent 3 & 4, P-3, Underside of deck between bents 3 and 4.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:2 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 5: Bent 3 & 4, P-3, Underside of deck between bents 3 and 4.



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 6: Bent 4, Underside between bents 4 and 5



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:3 of 66





Tags:Deck, Pile Caps, Report Photos	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 7: Bent 5, P-5, Underside between bents 5 and 6.		



Tags:Deck, Pile Caps, Report Photos	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 8: Bent 5, P-5, Underside between bents 5 and 6.		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:4 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 9: Bent 6, P-6, Underside between bents 6 and 7.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 10: Bent 6, P-6, Underside between bents 6 and 7.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:5 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 11: Bent 7, P-7, underside between bents 7 and 8.



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 12: Bent 7, Underside between Bent 7 and Bent 8.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:6 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 13: Bent 8, P-8, Underside between bents 8 and 9.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 14: Bent 8, P-8, Underside between bents 8 and 9.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:7 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 15: Bent 8, P-8, Underside between bents 8 and 9.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 16: Bent 8, Underside between bents 8 and 9.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:8 of 66





Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 17: Bent 9, P-9, Underside between Bents 9 and 10.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 18: Bent 10, P-10, Underside between Bents 10 and 11.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:9 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 19: Bent 10, P-10, Underside between Bents 10 and 11.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 20: Bent 10, Underside between 10 and 11.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:10 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 21: Bent 11, P-11, underside between bents 11 and 12.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 22: Bent 11, underside between bent 11 and 12



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:11 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 23: Bent 11, underside between bent 11 and 12



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 24: Bent 12, P-12, Underside between Bents 12 and 13. Large crack at the bottom of bent 12.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:12 of 66





Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 25: Bent 12, Underside between 12 and 13. Large crack at the bottom of bent 12.		



Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 26: Bent 12, Underside between 12 and 13. Large crack at the bottom of bent 12.		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:13 of 66





Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 27: Bent 13, P-13, underside between a bents 13 and 14.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 28: Bent 13, P-13, underside between a bents 13 and 14.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:14 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 29: Bent 15, P-15, Underside between bents 15 and 16.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 30: Bent 15, P-15, Underside between bents 15 and 16.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:15 of 66





Tags:Deck, Pile Caps	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 31: Bent 16, P-16, Underside between bents 16 and 17.		



Tags:Deck, Pile Caps	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 32: Bent 16, P-16, Underside between bents 16 and 17.		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:16 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 33: Bent 16, P-16, Underside between bents 16 and 17.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 34: Bent 17, P-17, Underside between Bents 17 and 18.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:17 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 35: Bent 17, P-17, Underside between Bents 17 and 18.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 36: Bent 18, P-18, Underside between bents 18 and 19.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:18 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 37: Bent 18, Underside between bent 18 and 19.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 38: Bent 20, P-20, Underside between Bents 20 and 21.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:19 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 39: Bent 20, Underside between bench 20 and 21.



Tags:Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 40: Bent 20, Underside between bench 20 and 21.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:20 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 41: Bent 21, P-21, Underside between bent 21 and 22.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 42: Bent 22, P-22, Underside between 22 and 23.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:21 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 43: Bent 22, Underside between 22 and 23.



Tags:Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 44: Bent 22, Underside between 22 and 23.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:22 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 45: Bent 24, P-24, Underside between bent 24 and 25.



Tags:Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 46: Bent 24, Underside between bent 24 and 25.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:23 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 47: Bent 25, P-25, Underside between bent 25 and 26.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 48: Bent 25, P-25, Underside between bent 25 and 26.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:24 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 49: Bent 27, P-27, Underside between bents 27 and 28.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 50: Bent 27, Underside between bent 27 and 28.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:25 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 51: Bent 28, P-28, Underside between bents 28 and 29.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 52: Bent 30, P-30, Underside between Bents 30 and 31.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:26 of 66





Tags:Fendering, Deck	Taken by:Matthew Seinuk	Date taken:03/12/2025
----------------------	-------------------------	-----------------------

Media 53: Bent 30, Underside between 30 and 31.



Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/12/2025
-----------	-------------------------	-----------------------

Media 54: Bent 30, Underside between 30 and 31.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:27 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 55: Bent 31, Underside between 31 and 32.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 56: Bent 31, Underside between 31 and 32.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:28 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 57: Bent 33, P-33, Underside between bents 33 and 34.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 58: Bent 34, P-34, Underside between bent 34 and 35.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:29 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 59: Bent 34, Underside between 34 and 35.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 60: Bent 36, P-36, Underside between bents 36 and 37.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:30 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 61: Bent 36, Underside between bent 36 and 37.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 62: Bent 37, P-37, Underside between bent 37 and 38.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:31 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 63: Bent 37, P-37, Underside between bents 37 and 38.



Tags:Fendering, Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 64: Bent 37, Underside between bent 37 and 38.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:32 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 65: Bent 37, Underside between bent 37 and 38.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 66: Bent 37, Underside between bent 37 and 38.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:33 of 66





Tags:Deck, Pile Caps	Taken by:Matthew Seinuk	Date taken:03/12/2025
----------------------	-------------------------	-----------------------

Media 67: Bent 38, P-38, Underside between bents 38 and 39.



Tags:Deck, Pile Caps, Report Photos	Taken by:Matthew Seinuk	Date taken:03/12/2025
-------------------------------------	-------------------------	-----------------------

Media 68: Bent 38, P-38, Underside between bents 38 and 39.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:34 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 69: Bent 39, P-39, Underside between bent 39 and bent 40.



Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 70: Bent 40, P-40, Underside between bents 40 and 41.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:35 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 71: Bent 42, P-42, Underside between bent 42 and 43.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 72: Bent 42, Underside between bent 42 and 43.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:36 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 73: Bent 44, P-44, Underside between bents 44 and 45.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 74: Bent 44, Underside between bents 44 and 45.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:37 of 66





Tags:Deck, Pile Caps, Report Photos

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 75: Bent 45, P-45, Underside between 46 and 45.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 76: Bent 45, P-45, Underside between 46 and 45.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:38 of 66





Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 77: Bent 45, P-45, Underside between bents 46 and 45.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 78: Bent 45, Underside between 46 and 45.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:39 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 79: Bent 46, Underside between 47 and 46.



Tags:Deck, Pile Caps

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 80: Bent 47, P-46, Underside between Bents 46 and 47.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:40 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 81: Bent 47, Underside between 47 and 48.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 82: Bent 47, Underside between 47 and 48.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:41 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 83: Bent 47, Underside between 47 and 48.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 84: Bent 48, Underside at outfall between 48 and 49.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:42 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 85: Bent 48, Underside at outfall between 48 and 49.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 86: Bent 48, Underside between bent 48 and 49



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:43 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 87: Bent 49, Underside between bent 49 and 50



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 88: Bent 50, Underside between bent 50 and 51



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:44 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 89: Bent 50, Underside between bent 51 and 50



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 90: Bent 52, Underside between bent 52 and 53



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:45 of 66





Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/12/2025
Media 91: Bent 53, Underside between bent 53 and 54		



Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/12/2025
Media 92: Bent 53, Underside between bent 53 and 54		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:46 of 66





Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 93: Bent 53, Underside between bent 53 and 54.		



Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 94: Bent 53, Underside between bent 53 and 54.		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:47 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 95: Bent 54, Underside between bent 54 and 55



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 96: Bent 55, Underside between bent 55 and bent 56



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:48 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 97: Bent 56, Underside between bent 56 and 57



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 98: Bent 56, Underside between bent 56 and 57



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:49 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 99: Bent 56, Underside between bent 56 and 57



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 100: Underside between bents 8 and 9.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:50 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 101: Underside between bents 8 and 9.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 102: Underside between Bents 9 and 10



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:51 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 103: Underside between Bents 9 and 10



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 104: Underside between bents 16 and 17.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:52 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 105: Underside between bents 23 and 24.



Tags:Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 106: Underside between bents 29 and 30.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:53 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 107: Underside between bents 30 and 31.



Tags:Deck, Report Photos

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 108: Underside between bents 33 and 34.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:54 of 66





Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 109: Underside between bents 35 and 36.



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 110: Underside between bents 43 and 44.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:55 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 111: Underside between bents 43 and 44.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 112: Underside between bents 43 and 44.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:56 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 113: Underside between bents 43 and 44.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 114: Underside between bents 43 and 44.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:57 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 115: Underside between bents 45 and 46.



Tags:Fendering, Deck

Taken by:Matthew Seinuk

Date taken:03/12/2025

Media 116: Underside between bents 47 and 48



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:58 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 117: Underside between bents 55 and 54.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 118: Underside between bents 55 and 54.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:59 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 119: Underside between bents 55 and 54.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 120: Underside between bents 55 and 54.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:60 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 121: Underside between bents 57 and 56.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 122: Underside between bents 57 and 56.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:61 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 123: Underside between bents 57 and 58.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 124: Underside between bents 57 and 58.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:62 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 125: Underside between bents five and six.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 126: Underside between bents five and six.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:63 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 127: Underside between bents five and six.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 128: Underside between bents six and seven.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:64 of 66





Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 129: Underside between bents six and seven.



Tags:Deck

Taken by:Matthew Seinuk

Date taken:03/11/2025

Media 130: Underside between vents 56 and 55.



Project name:Port of Albany Wharf

Project location:Albany

Client:Port of Albany

Project code:14990

Preparer:MAS

Reviewer:

Report date:2025-04-01

Page number:65 of 66





Tags:Deck	Taken by:Matthew Seinuk	Date taken:03/11/2025
Media 131: Underside of deck between bends three and four.		



Project name:Port of Albany Wharf	
Project location:Albany	
Client:Port of Albany	Project code:14990
Preparer:MAS	Reviewer:
Report date:2025-04-01	Page number:66 of 66